

IBM

Customer Installation Instructions

TS7520 Patch Update for 3954-CV6 Virtualization Engine

update-ve1382upto23-SP03— Cumulative patch fixing issues with enhancing Email Notification, fiber channel card recovery, failover recovery, x-ray collection, stub tape and data decompression. This patch includes patches update-ve13821201 to update-ve138223.

TS7520 Software Version 2.1 (Build 1382) Patch update-ve1382upto23-SP03

TS7520 SP03	Page 1 of 24			
Installation				
Instructions				

TS7520 Patch Update for 3954-CV6 Virtualization Engine

update-ve1382upto23-SP03— Cumulative patch fixing issues with enhancing Email Notification, fiber channel card recovery, failover recovery, x-ray collection, stub tape and data decompression. This patch includes patches update-ve13821201 to update-ve138223.

TS7520 Software Version 2.1 (Build 1382) Patch update-ve1382upto23-SP03

© Copyright International Business Machines Corporation 2007, 2008. All rights reserved. US Government Users Restricted Rights – Use, duplication or disclosure restricted by GSA ADP Schedule Contract with IBM Corp.

TS7520 SP03	Page 2 of 24			
Installation				
Instructions				

Before Installation (Section 1 through 5)

Warning:

Throughout this documentation, there are occurrences of service passwords and sudo commands that are used to manage and configure the product. Improper use of these commands and passwords poses significant risk to the product and your data. It is imperative that these commands and passwords are used only as documented.

1.0 Machines Affected

This is a field patch installation instruction for the TS7520 3954-CV6 Virtualization Engine.

This patch should be installed on all TS7520 systems, with software version 2.2 that do not have patch update-update-ve1382upto23-SP03 installed. TS7520 systems without this patch will not have support for the fixes within this patch.

Important Note:

Technical Bulletin Regarding TS7500 and Removing Failover Configurations

If a machine is in a failed-over state or a take-over state, **you must NOT attempt to remove failover**. In addition, if failover must be removed to change configurations of the machine (such as IP addresses, etc.) then it must be ensured that the system is not in a failed-over state, a take-over state, or a failover-suspended state. If any of these cases are true, call IBM support immediately.

1.1 Check Software version of TS7520

You can check the version of TS7520 software and determine whether or not the patch is already installed, using the VE Console *Version Info* tab.

- 1. If necessary, start the TS7500 Virtualization Engine management console (VE console) workstation by performing one of the following:
 - If there is a desktop shortcut for the **VE for Tape Console** application, double-click it.
 - If there is not a desktop shortcut for the VE for Tape Console application, click Start → All Programs → IBM → VE for Tape → VE for Tape Console.

Note: This is the default installation location for the **VE for Tape Console** application. The location of the application might differ for you.

TS7520 SP03	Page 3 of 24			
Installation				
Instructions				



- 2. Double-click **VE for Tape Servers** to expand the TS7500 list.
- 3. Double-click any server icon.
- 4. In the VE for Tape User Login window, enter the following user name and password:

Userid: vetapeuser

Password: veuserpassword

Note: The user name and password are case-sensitive

5. Click on the VE Console *Version Info* tab (refer to Figure-1) to see what patches you have installed. If you see update-ve1382upto23-SP03 mentioned in the version info, then you already have this patch installed. Please close the VE Console after you have verified this information.

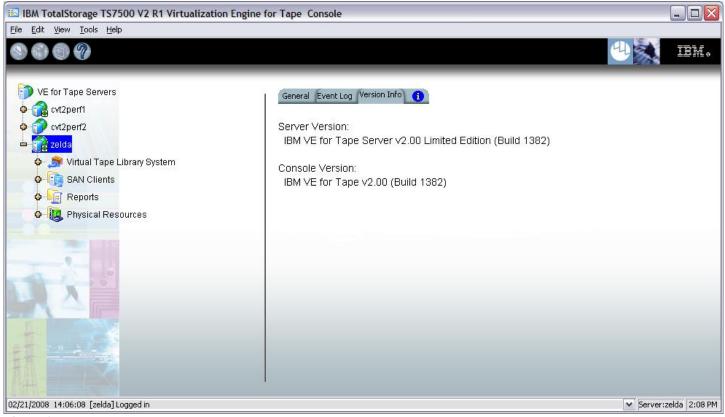


Figure 1

TS7520 SP03	Page 4 of 24			
Installation				
Instructions				



2.0 Prerequisites

If using a 64-bit Windows host, ensure the installed level of the IBMTape driver is at a minimum of 6.1.8.2 or higher.

You may also require the following software CDs if your system is not at the required levels for this patch (steps to verify this are provided in this document). ISO images for this software are also available from the following Virtualization Engine patch download page:

http://www-1.ibm.com/support/search.wss?rs=1174&tc=HW29K&q=ssg1*&dc=D400&dtm

- TS7500 Software Upgrade Disk Version 2.2.2 (LCD8-0687-01) http://www.elink.ibmlink.ibm.com/publications/servlet/pbi.wss
- TS7520 CVT Console Installation Disk v2.2.3 1382-06 (EC L30806 Part number 45E2071)

Attention:

Special notes for HA (High Availability) configurations

In each step, there will be times when the servers are required to be restarted or rebooted. Since this will trigger a failover, it is required that failover is **suspended**. Instructions on how to suspend failover can be found in section 3.1 of this document.

Removing failover is **not recommended** and should never be done unless directed by IBM support prior to doing so.

If failover has been not configured yet, it is IBM's advice to first install the upgrades and patches outlined in this document prior to configuring HA. After failover has been suspended, it is important to allow enough time for the systems to activate their Primary Server IPs. While in most cases, it takes only 2 to 3 minutes for the server IP to become active, it can take a bit longer. If after 20 minutes, the server IP access has not been restored, please call IBM support for assistance.

2.1 TS7520 Software Upgrade CD

The TS7520 Software Upgrade CD must be applied prior to installing this patch. To check if the Software Upgrade CD has already been applied, perform the following steps:

1. Open a PuTTY Session by performing the following steps from the PuTTY console:

Note: If PuTTY is not installed, refer to "Install PuTTY on VE Console" in the TS7520 User's Guide (GC27-2068-02) and return to this point once complete.

TS7520 SP03 Installation	Page 5 of 24			
Instructions				



- 2. Click Start.
- 3. Click All Programs.
- 4. Click **PuTTY**.
- 5 Click **PuTTY**
- 6. Enter IP Address of the server you are connecting to where specified.
- 7. Select **Open**.
- 8. Enter the following userid and password. The userid and password are case-sensitive.
 - Userid: vetapeuser
 - Password: veuserpassword
- 9. At the command prompt, enter the following command: cat /var/log/ve.log | more
- 10. Press enter and examine the /var/log/ve.log file on the CVT server for messages similar to those in Figure-2 below:

```
Mon Feb 25 16:08:25 UTC 2008 Software Upgrade CVT2.0 configuration to CVT2.2. Install Director Core Services version 5.20.1. Install IBM Electronic Service Agent for xSeries 5.0. Modifying sudoers. Mon Feb 25 16:13:22 UTC 2008 Updating Storage Manager packages. Mon Feb 25 16:15:03 UTC 2008 UPGRADING TO CVT2.2 COMPLETED SUCCESSFULLY. Figure 2
```

• If the messages are present, then the SW Upgrade CD was previously installed and there is no need to install it again. Continue to section 2.2 - TS7520 CVT Console Installation Disk v2.2.3 1382-06 If the messages are not present, the SW Upgrade CD must be installed. Continue to section 2.1.2 - Installation of the TS7520 Software Upgrade CD

2.1.2 Installation of the TS7520 Software Upgrade CD

To install the TS7520 Software Upgrade CD, perform the following steps:

Note: Press enter after typing commands at the command prompt.

- 1. Obtain the TS7520 Software Upgrade CD with part number: LCD8-0687-01
- 2. If necessary, repeat steps 1 through 4 in section 1.1 to start the **VE for Tape Console** application and log into the server through the VE for Tape Console.
- 3. Perform one of the following, depending upon whether one or two TS7520 Servers are installed in the 3954 F05 frame:
 - If two servers are installed and Failover has been configured, Suspend Failover on both the lower and the upper servers as described in section 3.1 of this document and continue to step 4. Note: To suspend failover; right click on the library and select Failover → Suspend Failover from the popup menu.
 - If **one** server is installed, go to step 4.

TS7520 SP03	Page 6 of 24			
Installation				
Instructions				



- 4. Place the TS7520 Software Upgrade CD into the DVD drive of the lower TS7520 server.
- 5. If necessary, repeat steps 1 through 8 in section 2.1 to log into the server through the PuTTY Console.
- 6. Mount the CD by running the following command at the command prompt:

sudo mount /dev/hda /media/cdrom

- 7. Run the Software Upgrade by running the following command at the command prompt: sudo /media/cdrom/Software upgCVT2.2/upgCVT2.2
- 8. Type 'yes' to proceed when prompted.

Note: During the upgrade process, you will see status messages on the screen displaying the percentage complete of installing various software packages. This is normal.

If you see a series of messages similar to the following scroll past on the screen, just **press** <enter> afterwards to be taken to the command prompt again.

"Checking device /dev/sday (/dev/sg50): Skipping"

```
zelda:~ # /media/cdrom/Software_upgCVT2.2/upgCVT2.2
               WARNING: Ve will stop.
               Do you want to continue (yes/no)?
              Startina ...
              Software Upgrade CVT2.0 configuration to CVT2.2.
              Installing RETAIN packages. Please wait...
              Updating Storage Manager packages.
              Preparing...
                               1:SMruntime
                                ############### [ 25%]
              Stopping Agent process 13015.
               2:SMagent
                                ############### [ 50%]
              SMagent started.
              Stopping SMmonitor process 4616
              SMmonitor has been stopped.
              /var/tmp/rpm-tmp.66469: line 5: /etc/rc.d/init.d/SMmonitor: No such file or directory
                3:SMclient
                               SMmonitor started.
                4:SMutil
                              ############### [100%]
              UPGRADING TO CVT2.2 COMPLETED SUCCESSFULLY.
              Please verify the patches for CVT2.2..
              * Please unmount the CDROM and eject it *
              * then REBOOT the server
              zelda:~ # IBM System Storage DS4000/FAStT Storage Manager Agent, Version 09.23.A5.00
              Built Mon Mar 05 09:39:29 CST 2007
              (C) Copyright International Business Machines Corporation, 2003-2007 Licensed Material - Program Property of IBM. All rights reserved.
              Checking device /dev/sda (/dev/sg0): Skipping
              Checking device /dev/sdb (/dev/sg1) : Skipping
              Checking device /dev/sdk (/dev/sg10): Skipping
              Checking device /dev/sdl (/dev/sgl1): Skipping
              Checking device /dev/sdm (/dev/sg12) : Skipping
              Checking device /dev/sdn (/dev/sg13) : Skipping
              Checking device /dev/sdo (/dev/sg14): Skipping
              Checking device /dev/sdp (/dev/sg15): Skipping
              Checking device /dev/sdq (/dev/sg16) : Skipping
              Checking device /dev/sdr (/dev/sg17): Skipping
TS7520 SP03
               Page 7 of 24
Installation
Instructions
```



Checking device /dev/sds (/dev/sg18) : Skipping				
Checking device /dev/sdt (/dev/sg19) : Skipping				
Checking device /dev/sdc (/dev/sg2) : Skipping				
Checking device /dev/sdu (/dev/sg20) : Skipping				
Checking device /dev/sdv (/dev/sg21) : Skipping				
Checking device /dev/sdw (/dev/sg22) : Skipping				
Checking device /dev/sdx (/dev/sg23) : Skipping				
Checking device /dev/sdy (/dev/sg24) : Skipping				
Checking device /dev/sdz (/dev/sg25) : Skipping				
Checking device /dev/sdaa (/dev/sg26) : Skipping				
Checking device /dev/sdab (/dev/sg27) : Skipping				
Checking device /dev/sdac (/dev/sg28) : Skipping				
Checking device /dev/sdad (/dev/sg29) : Skipping				
Checking device /dev/sdd (/dev/sg3): Skipping				
Checking device /dev/sdae (/dev/sg30) : Skipping				
Checking device /dev/sdaf (/dev/sg31): Activating				
Checking device /dev/sdag (/dev/sg32) : Skipping				
Checking device /dev/sdah (/dev/sg33) : Skipping				
Checking device /dev/sdai (/dev/sg34) : Skipping				
Checking device /dev/sdai (/dev/sg35): Skipping				
Checking device /dev/sdak (/dev/sg36): Skipping				
Checking device /dev/sdal (/dev/sg37) : Skipping				
Checking device /dev/sdam (/dev/sg37): Skipping				
Checking device /dev/sdam (/dev/sg39): Skipping				
Checking device /dev/sde (/dev/sg4) : Skipping				
Checking device /dev/sdao (/dev/sg40) : Skipping				
Checking device /dev/sdap (/dev/sg41) : Skipping				
Checking device /dev/sdaq (/dev/sg42): Skipping				
Checking device /dev/sdar (/dev/sg43) : Skipping				
Checking device /dev/sdas (/dev/sg44): Skipping				
Checking device /dev/sdat (/dev/sg45) : Skipping				
Checking device /dev/sdau (/dev/sg45): Skipping				
Checking device /dev/sdav (/dev/sg47) : Skipping				
Checking device /dev/sdaw (/dev/sg48) : Skipping				
Checking device /dev/sdax (/dev/sg49): Skipping				
Checking device /dev/sdf (/dev/sg5) : Skipping				
Checking device /dev/sday (/dev/sg50) : Skipping				
Checking device /dev/sday (/dev/sg51) : Skipping				
Checking device /dev/sdba (/dev/sg52): Skipping				
Checking device /dev/sdbb (/dev/sg53) : Skipping				
Checking device /dev/sdbs (/dev/sg54): Skipping				
Checking device /dev/sdbd (/dev/sg55) : Skipping				
Checking device /dev/sdba (/dev/sg55): Skipping				
Checking device /dev/sdbe (/dev/sg57) : Skipping				
Checking device /dev/sdbi (/dev/sg58) : Skipping				
Checking device /dev/sdbh (/dev/sg59): Skipping				
Checking device /dev/sdg (/dev/sg6) : Skipping				
Checking device /dev/sdbi (/dev/sg60) : Skipping				
Checking device /dev/sdbi (/dev/sg61) : Skipping				
Checking device /dev/sdbk (/dev/sg62): Skipping				
Checking device /dev/sdbl (/dev/sg63) : Skipping				
Checking device /dev/sdbm (/dev/sg64) : Skipping				
Checking device /dev/sdbm (/dev/sg65) : Skipping				
Checking device /dev/sdbo (/dev/sg66) : Skipping				
Checking device /dev/sdbb (/dev/sg67): Skipping				
Checking device /dev/sdbp (/dev/sg68): Activating				
Checking device /dev/sdbq (/dev/sg69) : Skipping				
Checking device /dev/sdb/ (/dev/sg7): Skipping				
Checking device /dev/sdbs (/dev/sg70) : Skipping				
Checking device /dev/sdbt (/dev/sg71): Skipping				
Checking device /dev/sdbu (/dev/sg72) : Skipping				
Checking device /dev/sdbv (/dev/sg73) : Skipping				
Checking device /dev/sdi (/dev/sg8) : Skipping				
Page 8 of 24	†	i	1	

TS7520 SP03	
Installation	
Instructions	

Pag	ge 8 of 24			



Checking device /dev/sdj (/dev/sg9) : Skipping

Running...

- 9. Unmount the CD-ROM disk by running the following command at the command prompt: sudo umount /dev/hda
- 10. Eject the CD-ROM disk by running the following command at the command prompt: sudo eject /dev/hda
- 11. Reboot the server by running the following command at the command prompt: sudo shutdown -r now
- 12. Repeat steps 4 through 12 on any other servers present.
- 13. If failover was suspended, failover should be resumed on both servers after they have completely finished rebooting by following the steps given in section 6.3 of this document.

TS7520 SP03	Page 9 of 24			
Installation				
Instructions				



2.2 TS7520 CVT Console Installation Disk v2.2.3 1382-06

The client portion of this patch requires that your console be at the above mentioned version. To verify if the **VE for Tape Console** application is at the required level, perform the following steps:

- 1. If necessary, repeat steps 1 through 4 in section 1.1 to start the **VE for Tape Console** application.
- 2. Click Help → About TotalStorage TS7500...
 - a. If you have Build 1382-06 Update 2 Build Date: "Sep 11, 2008", as seen in the figure below, then you are at the required level including patch upto23 and should proceed to section 2.3 to install the server portion of patch upto23.



Figure 3

b. If you have Build 1382-05 Update 2 Build Date: "Jul 22, 2008", as seen in the figure below, then you are at the 2.2 version of the console. You should proceed to section 2.3 to install the server portion of the patch upto23 and then proceed to section 6.2 to patch your console.



Figure 4

Installation	Page 10 of 24			
Instructions				



c. If you have Build 1382-04 Update 2 Build Date: "Jun 26, 2008", as seen in the figure below, then you are at the 2.2 version of the console. You should proceed to section 2.3 to install the server portion of the patch upto23 and then proceed to section 6.2 to patch your console.



Figure 5

d. If you have Build 1382 Build Date: "Oct 11, 2007", as seen in the figure below, then you are at the 2.2 version of the console. You should proceed to section 2.3 to install the server portion of the patch upto23 and then proceed to section 6.2 to patch your console.

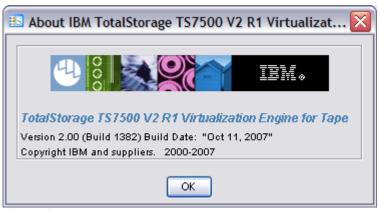


Figure 6

e. If you have Build 1382 Build Date: "May 08, 2007", as seen in the figure below, then you are **not** at the 2.2 level of the console and will need to upgrade your VE console.

TS7520 SP03	Page 11 of 24			
Installation				
Instructions				



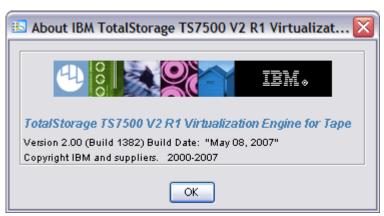


Figure 7

Perform the following steps to install the correct console version:

- i. Obtain the TS7520 CVT Console Installation Disk v2.2.3 1382-06 with part number: **45E2071**
- ii. Locate the TS7520 User's Guide (GC27-2068-02)
- iii. Go to the "Installing the VE console on a workstation running Windows" section in chapter 2 of the TS7520 User's Guide and follow the instructions on installing the VE console.

Note: Please record the directory path where you install the VE for Tape Console if you do not use the default path. You will also need to follow the steps in sections "Starting the VE Console" and "Connecting to the TS7500 Virtualization Engine" to re-establish the connection between the TS7500 VE for Tape Console and all the TS7500 Virtualization Engine Servers which you want to manage using this VE for Tape Console.

- iv. Once finished, repeat step 2 to verify that the required VE console is installed.
- v. If the required version is listed, proceed to section 2.3 Obtain the latest Installation Instruction and the patch file. If the version is still incorrect, please call IBM support for assistance.

TS7520 SP03	Page 12 of 24			
Installation				
Instructions				

2.3 Obtain the latest Installation Instruction and the patch file

Download the latest patch by completing the following steps:

- 1. Using the VE console workstation, go to the following Virtualization Engine patch download page: http://www-01.ibm.com/support/search.wss?rs=1174&tc=HW29K&q=ssg1*&dtm%20&dc=D400&dtm
- 2. Select the following patch level files and save these to a directory on the VE console workstation.
 - TS7520 Patch update-ve1382upto23-SP03
 - o update-ve1382upto23-SP03.zip
 - o CVT2.2-Console-1382-06.zip

TS7520 SP03	Page 13 of 24			
Installation				
Instructions				

3.0 Preparation

Installation of this patch is disruptive to normal TS7520 operation. Application of the patch will cause the 3954-CV6 server software, as well as the CV6 server, to shutdown and restart. Schedule time when the TS7520 system can be taken out of normal operation.

Attention:

Ensure that all host jobs to the TS7520 are quiesced, and complete all pending TS7520 operations.

3.1 Suspend Failover (Only for systems with Failover configured)

For HA configurations (FC-7420 Failover/Failback Enable), use the **VE for Tape Console** application to Suspend Failover on both 3954-CV6 servers in the frame. Refer to Figure 8 and Figure 9, and use the following procedure to Suspend Failover on each server in the frame (both the upper and lower server if in an HA environment).

1. If necessary, repeat steps 1 through 4 in section 1.1 to start the **VE for Tape Console** application and login to the VE for Tape server, or highlight the VE for Tape server if already connected, using the following userid and password:

Userid: vetapeuser

Password: veuserpassword

- 2. From the **VE for Tape Console** application, right-click the TS7520 Server.
- 3. Click Failover \rightarrow Suspend Failover. Refer to Figure 9.

TS7520 SP03	Page 14 of 24			
Installation				
Instructions				



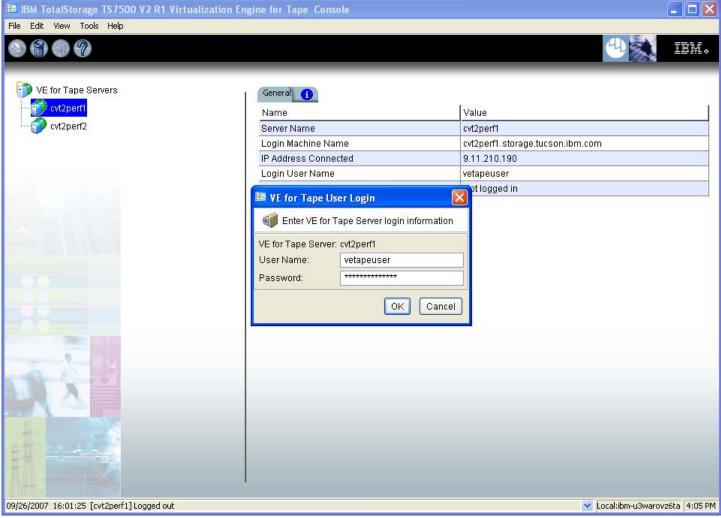



Figure 8

WARNING:

You must choose **Suspend Failover** and not Remove Failover Server or any of the other options, otherwise unpredictable results may occur.

TS7520 SP03	Page 15 of 24			
Installation				
Instructions				



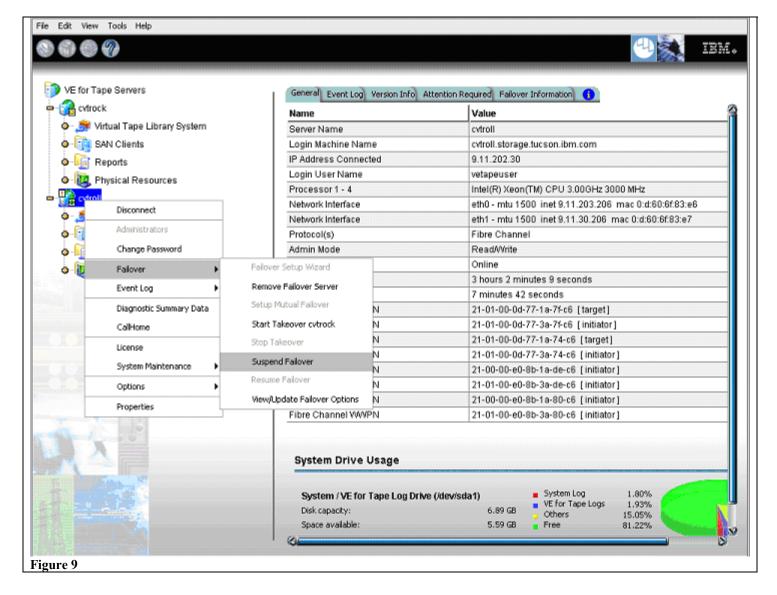

4.0 Purpose and Description

This patch should be installed on all TS7520 systems, with software version 2.2 that do not have patch update-ve1382upto23-SP03 installed. TS7520 systems without this patch will not have support for the fixes in this patch.

5.0 Installation Time

The average time to install this patch on a HA configuration is 1.0 hour. The number of persons required to install the patch is 1.

TS7520 SP03	Page 16 of 24			
Installation				
Instructions				



Installation (Section 6 through 7)

6.0 Details of Installation

Perform the steps outlined in section 6.1 on each server present before proceeding to section 6.3. You should always start with the lower server in the frame and proceed to the upper server.

6.1 Patch Installation

Use the following procedure to install the patch on each 3954-CV6 VE for Tape server (both the upper and lower server if in an HA environment). Refer to Figure 10 through Figure 17.

- 1. Use a zip utility program to extract the contents of update-ve1382upto23-SP03server.zip to a directory on your hard drive. Note this location as you will require this information in Step 5.
- 2. If necessary, repeat steps 1 through 4 in section 1.1 to start the **VE for Tape Console** application.
- 3. Highlight the VE for Tape server and click $Tools \rightarrow Add\ Patch$ (Figure 10)

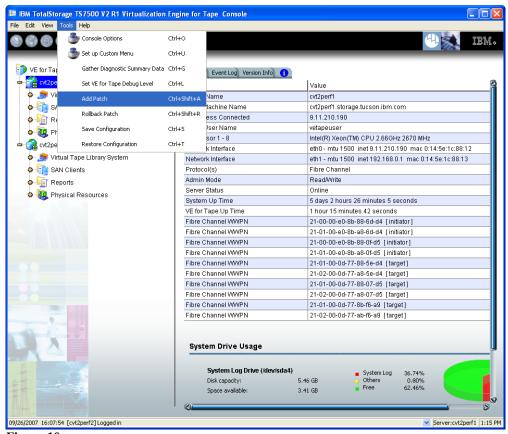


Figure 10

TS7520 SP03 Installation	Page 17 of 24			
Instructions				



4. Select "OK" when presented with the following Warning Message (Figure 11).



Figure 11

5. When presented with the Select Patch File window (Figure 12), index to the VE Console workstation directory where you unzipped the *update-ve1382upto23-SP03* patch file and select the file.

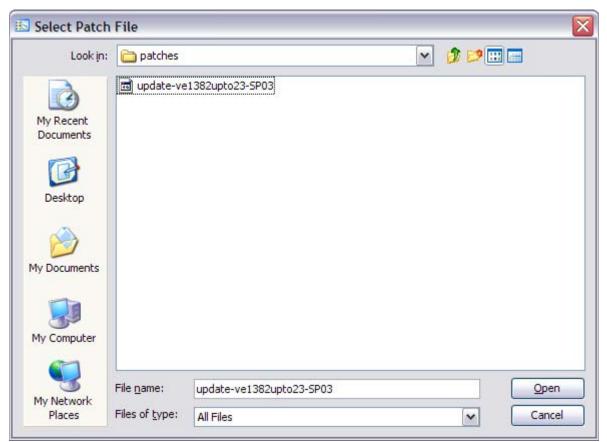


Figure 12

6. When presented with the confirmation window, type "YES" to confirm (Figure 13)

Installation	Installation	Page 18 of 24					
--------------	--------------	---------------	--	--	--	--	--



Add Patch to VE for Tape Server "cvt3perf2"	×
Please confirm you wish to add patch: "update-ve1382upto23-5P03"	
Description: "2.2.3.23 service pack including all fixes up to 23 to Build 1382 on kernel 2.6.5-390; requiring server reboot. Requires consol	e patch CVT2.2-Console-1382-06."
Type YES to confirm:	
	<u>OK</u> <u>C</u> ancel

Figure 13

7. If the "Add Patch to VE for tape Server" window appears, click OK. (Figure 14)

Note: The server software will shutdown and restart.



Figure 14

8. The **VE for Tape Console** application will be disconnected from the VE for Tape server (Figure 15).



Figure 15

9. Once the server software has completed the restart (approximately 2 to 5 minutes) you will be able connect to the VE for Tape server from the **VE for Tape Console** application (Figure 16).

TS7520 SP03	Page 19 of 24			
Installation				
Instructions				

© Copyright IBM Corp.2008



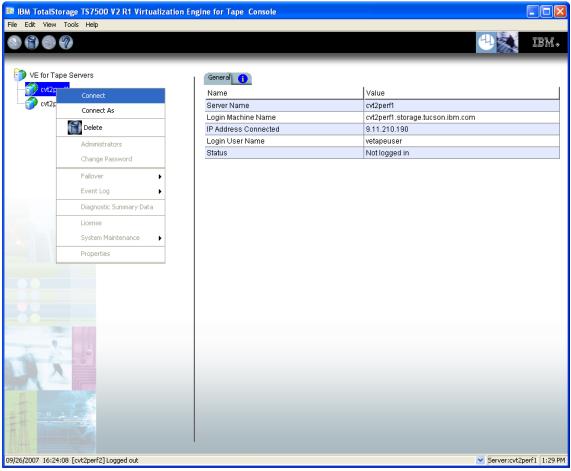


Figure 16

10. Check the TS7520 Version Information of each server, using the **VE for Tape Console** application *Version Info* tab, to confirm the successful installation of the patch (refer to Figure 17). There should be a Version Info entry stating "Completed installation of update-ve1382upto23-SP03, patch applying all fixes up to 23 to Build 1382 on kernel 2.6.5-390; requiring server reboot".

Note: You may have to scroll to the bottom of the window to find this entry depending on the configuration of your TS7520.



12Sep08_092147 Install update-ve138215, patch fixing issue with incorrect replica tape size after shrinking a tape 12Sep08_092149 Install update-ve138217, patch fixing an issue with unloading physical tape, and providing auto shrink of replica, and a message for replica shrink failure

12Sep08_092159 Install update-ve138223, patch fixing issues with FC Qlogic to display host login related messages only in debug mode, IBM3494 tape library, expansion; making a new initrd image and requiring server reboot

12Sep08_092135 Completed installation of update-ve1382upto23-SP03, 2.2.3.23 service pack including all fixes up to 23 to Build 1382 on kernel 2.6.5-390; requiring server reboot. Requires console patch CVT2.2-Console-1382-06.

Figure 17

TS7520 SP03	Page 20 of 24			
Installation				
Instructions				



11. After patch installation has been verified, the server must be rebooted.

Open a PuTTY Session by performing the following steps from the PuTTY console:

Note: If PuTTY is not installed, refer to "Install PuTTY on VE Console" in the TS7520 User's Guide (GC27-2068-02) and return to this point once complete.

- a. Click Start.
- b. Click All Programs.
- c. Click PuTTY.
- d. Click PuTTY.
- e. Enter IP Address of the server you are connecting to where specified.
- f. Select **Open**.
- g. Enter the following userid and password. The userid and password are case-sensitive.
- h. Login: vetapeservice
- i. Password: service4u
- i. At the command prompt, enter the following command:
- k. sudo shutdown -r now
- 12. After the server reboots in 5-10 minutes, continue to section 6.2

Note: Repeat the above steps (section 6.1) on the second server if in an HA configuration.

Contact IBM support for assistance if the patch installation did not complete successfully.

6.2 VE Console Patch Installation

Perform the following steps on the VE console workstation.

Note:

- Do not perform the following steps if the VE console is not at the required level. Refer to section 2.2 TS7520 CVT Console Installation Disk v2.2.3 1382-06.
- If the **VE for Tape Console** application is open, please close the application prior to performing these steps.
- 1. Perform the following steps to backup the IPStorConsole.jar file:
 - a. Navigate to the C:\Program Files\IBM\VE for Tape\Console\Bin\ directory and locate your IPStorConsole.jar file.

Note: This directory may vary if you did not choose the default install location in Section 2.2.

b. Right click on the **IPStorConsole.jar** file and select **rename** from the pop up window. Rename this file to IPStorConsole.old.

TS7520 SP03	Page 21 of 24			
Installation				
Instructions				

© Copyright IBM Corp.2008



- c. Select Yes on the pop up confirmation window, if displayed.
- 2. Use a zip utility program to extract the contents of CVT2.2-Console-1382-06.zip to the C:\Program Files\IBM\VE for Tape\Console\Bin\ directory. The zip file includes a new version of **IPStorConsole.jar**.
 - a. Navigate to the C:\Program Files\IBM\VE for Tape\Console\Bin directory and locate the file CVT2.2-Console-1382-06.jar.
 - b. Right click on the file CVT2.2-Console-1382-06.jar and select rename from the pop up window. Rename this file to IPStorConsole.jar.
- 3. If prompted whether or not you wish to replace the destination files, choose **ves**.
- 4. You can verify that the patch was properly installed by starting the **VE for Tape Console** application and selecting the **Help → About menu**. If you are at Version 2.00 (Build 1382-06 Update 2) Build Date: "Sep 11, 2008", refer to the figure below, then you have successfully applied the VE console portion of this patch.



Figure 18

TS7520 SP03 Page 22 of 2 Installation Instructions	4				
--	---	--	--	--	--

6.3 Resume Failover (Only for systems with Failover configured)

Attention:

Only perform this step if the steps in 6.1 have been successfully performed on both the upper and lower servers in the failover pair. If you have not already done so, perform the steps in 6.1 on the other member of the failover pair.

For HA configurations (FC-7420 Failover/Failback Enable), use the **VE for Tape Console** application to Resume Failover on both 3954-CV6 servers. Refer the following procedure to Resume Failover **on each server present (both the upper and lower server if in an HA environment).**

1. If necessary, repeat steps 1 through 4 in section 1.1 to start the **VE for Tape Console** application and login to the VE for Tape server (Figure-3), or highlight the VE for Tape server if already connected, using the following userid and password:

Userid: vetapeuser

Password: veuserpassword

- 2. From the VE console, right-click the TS7520 Server.
- 3. Click Failover \rightarrow Resume Failover.
- 4. Repeat for upper server if in an HA environment.

TS7520 SP03 Installation	Page 23 of 24			
Instructions				

7.0 Rolling Back Patches

Warning: Patch rollback should be done only as per recommendation of your Technical Support Representative. Improper rollback of a patch may cause damage to your system. Contact IBM support for assistance if you need to rollback **update-ve1382upto23-SP03**.

TS7520 SP03	Page 24 of 24			
Installation				
Instructions				